



AIC Head Office,  
Level one, NAQIA Haus, Portion 81, Morea Tobo Rd, 6 Mile  
PO Box 1709, Boroko 121  
National Capital District  
Papua New Guinea

Telephone: (675) 327 9000  
Facsimile: (675) 323 2139  
Email: [mwal@aic.gov.pg](mailto:mwal@aic.gov.pg)

Our Ref: AIC 25-R04/24-1002

**Safety recommendation: AIC 25-R04/24-1002**

**Addressed to: Kobio Aviation Limited**

**Date issued: 28 April 2025**

**Investigation link: AIC 24-1002**

**Action status: Issued**

## **Introduction**

On 19 October 2024 at 16:05 local time (06:05 UTC), the AIC was notified by NiuSky Pacific about an occurrence that had occurred on the same day at 15:00 local time (05:00 UTC). The occurrence involved a De Havilland Aircraft of Canada Ltd DHC-6-300 Twin Otter aircraft registered P2-KAL, owned by ASHE Aircraft Enterprises Limited, and operated by Kobio Aviation Limited.

The AIC immediately began gathering information pertinent to the occurrence and commenced an investigation into the occurrence.

## **Occurrence**

On 19 October 2024, at 15:00 local time (05:00 UTC), a De Havilland Aircraft of Canada Ltd DHC-6-300 Twin Otter aircraft registered P2-KAL, owned by ASHE Aircraft Enterprises Limited, and operated by Kobio Aviation Limited, was conducting a VFR charter flight from Kairik Airport, Enga Province to Mt. Hagen Airport, Western Highlands Province, Papua New Guinea, when during the takeoff roll, it experienced a runway excursion and rolled into a drainage ditch which runs along the left side of the runway and impacted the embankment.

## **Safety deficiency description**

According to the Route Guide Manual, Section 2.6.2 "Categorization":

*The category of an airport is used for the purpose of determining airport qualification requirements. There are three airport categories—A, B, and C. The categorization is based on the criteria outlined in Chapter 2, Section 2.16 "Airport Categorization." Only primary and alternate airports are categorized.*

The Route Guide Manual, Section 2.16.2 "Airport Categorization Criteria," states:

*For the purpose of determining the training required by the Pilot-in-Command (PIC) to meet aerodrome approval requirements, airports are categorized in ascending order of difficulty from Category A to Category C. The categories are defined as follows:*

Category A airports satisfy all of the following criteria:

1. Have a published instrument approach procedure (e.g. LOC, LLZ, ADF, VOR, GPS RNAV)
2. Have at least one runway with no performance-limiting procedures for take-off and/or landing
3. Have a published circling minimum ceiling no higher than 1,500 feet above airport elevation

Category B airports are those that do not satisfy Category A requirements or require additional considerations, such as:

1. Terrain and/or obstructions that abnormally constrain approaches or departures (e.g. turns on approach or departure below 500 ft AGL or greater than 150°)
2. Unusual approach or departure procedures
3. Known extreme local weather conditions (e.g. turbulence due to surrounding topography)

Category C airports are those that require further considerations beyond those identified for Category B airports.

The operator classified Kairik Airport as a Category C airport. However, the investigation found no recorded data from the operator to verify this classification.

The investigation also found that the pilot ICUS was undergoing command endorsement training on their first day in the left seat, with the accident flight being their first time in command under supervision. Kairik, a Category C aerodrome, classified as the most challenging in the operator's Route Guide Manual, presents additional complexities such as a narrow, sloped runway and minimal infrastructure. Initial command training should begin at simpler aerodromes (Category A or B) to allow pilots transitioning to the left seat to focus on command ability, decision-making, communication, and handling from the left seat, without the added pressure of operational and environmental challenges. Pilots transitioning from the right to the left seat are adjusting to new responsibilities (e.g., ATC communications, aircraft control priority, checklist flow). A simpler aerodrome offers more margin for error during this critical phase—longer runways, better navigation aids, and fewer terrain or wind challenges. Kairik Airport has narrow and sloped runway or minimal infrastructure so introducing these variables too early in a left-seat upgrade could lead to cognitive overload or unsafe situations during the check.

### **Recommendation number AIC 25-R04/24-1002 to Kobio Aviation Limited**

The PNG Accident Investigation Commission recommends that Kobio Aviation Limited implement a phased training approach for pilots undergoing command endorsement, starting with less challenging aerodromes before progressing to Category C aerodromes like Kairik Airport.

### **Action requested**

The AIC requests that Kobio Aviation Limited note recommendation AIC 25-R04/24-1002 and provide a response to the AIC within 90 days of the issue date, but no later than 28 July 2025, and explain (including with evidence) how Kobio has addressed the safety deficiency identified in the safety recommendation.

**STATUS: ISSUED.**



**Maryanne J. Wal**

*Chief Commissioner*

28 April 2025